

[Total man-hours, 357; total man-hour cost, \$597.44; total parts cost, \$784]—Continued

Description	Man-hours (hours and 10ths)	Federal stock No.	Part source code	Quantity	Parts cost
POWER TRAIN SYSTEM					
Adjust clutch pedal of free travel.....	1.50	2590-314-0745 Harness....	REP	1 EA	\$8.14
Overhaul defective transmission replacing damaged parts with cleaning and adjusting work.	39.00	2590-606-6504 Kit.....	REP	1 EA	1.77
		805-624-4765 Lock.....	REP	5 EA	.40
Replace transfer vent line pipe and check its function.	1.50	805-690-781 Hose.....	REP	1 EA	.36
		2910-696-0348 Cable.....	REP	1 EA	3.02
Cannibalize propeller shaft between transfer and intermediate, transfer and pillow block, transfer and front for missing one.	8.00	2805-735-0443 Hose.....	REP	3 EA	1.23
		2805-735-0444 Hose.....	REP	1 EA	1.10
		2910-735-0572 Collar.....	REP	1 EA	.06
Cannibalize intermediate drive shaft, 8 ea of attaching nuts and gaskets for missing one.	4.00	2805-741-1604 Gasket....	REP	1 EA	2.58
Check air hydraulic cylinder of its function and engine repair.	2.50	2910-741-2431 Kit.....	REP	1 EA	4.21
		3030-517-1169 Belt.....	REP	1 EA	.24
Replace 12 ea of damaged wheel cylinders and 12 ea of bleeder valves.	7.50	3110-143-7538 Cone.....	REP	2 EA	5.00
		3110-144-8998 Bearing....	REP	1 EA	.71
Service hand brake system with replacing dam- aged parts and adjusting work.	2.00	4030-741-0659 Shackle....	REP	4 EA	13.60
		4730-014-2433 Nut.....	REP	2 EA	.08
		4730-202-6491 Elbow.....	REP	1 EA	.09
		4720-203-2668 Hose.....	REP	4.92FT	.29
STEERING SYSTEM					
Adjust steering gear, steering drag link, pitman arm, replace cracked steering wheel, steering box oil seal.	6.00	4730-221-6215 Elbow.....	REP	2 EA	.48
		4720-235-1781 Tube.....	REP	10 FT	.30
		4820-275-2225 Cock.....	REP	1 EA	.26
Service spring shackles, torque rod, repair right front clip band of dent.	4.00	4730-278-2977 Plug.....	REP	1 EA	.11
		4730-496-7511 Elbow.....	REP	1 EA	.22
		4730-702-2750 Clamp.....	REP	5 EA	.85
		4730-720-1398 Clamp.....	REP	1 EA	.30
FRAME					
Repair front bumper of dent and stone shield of dent, install 4 ea of missing shackles and 2 ea of pintle pins, tighten 4 ea of loose tie down U-bolts.	4.50	4730-741-2089 Elbow.....	REP	1 EA	.24
		4730-741-2689 Elbow.....	REP	1 EA	.24
		5310-741-2088 Washer....	REP	5 EA	.05
		5310-711-2088 Washer....	REP	4 EA	.04
		5310-275-635 Gasket.....	REP	15 EA	.45
		5310-276-8674 Retainer...	REP	1 EA	.14
SHEET METAL					
Repair hood of crack, plug up hole at removed heater and remove its bracket, repair right fender of dent, install 2 ea of missing bolts, tighten loose mounting bolt on left hand.	26.00	5310-741-2088 Washer....	REP	15 EA	.15
		5315-058-8606 Pin.....	REP	3 EA	.12
		5315-845-4232 Pin.....	REP	2 EA	.10
		5315-846-0126 Pin.....	REP	2 EA	.04
		5320-264-3171 Rivet.....	N/C	100 EA	---
		5325-011-7965 Grommet...	REP	2 EA	.10
CAB AND ASSOCIATED PARTS					
Service cab mounting, windshield, windshield wiper and control, door, seat, mirror, cab floor, interior trim, replacing roof panel right side upper, door check arm, cowl ventilator seals, side handle weather	28.00	5330-700-0669 Packing....	REP	1 EA	.03
		5330-741-1429 Seal.....	REP	6 EA	6.00
		5935-306-2063 Connector..	REP	1 EA	.04
		5935-776-0599 Connector..	REP	6 EA	1.32
		5340-282-7542 Clamp.....	REP	4 EA	.84
				1 EA	.40