

AID'S MISMANAGEMENT OF THE EXCESS PROPERTY PROGRAM 115

8a. Signature (*Person(s) performing inspection*): Mr. Borja, TCN, Maint. Branch USAID/LOG.

9a. Signature (*Maintenance Supervisor*): David May, Maint. Branch USAID/LOG.

TM item No.	Sta- tus	Deficiencies and shortcomings	TM item No.	Sta- tus	Deficiencies and shortcomings
1	(**)	Oil leaking from rear crankshaft seal.	12	(**)	Lubricate chains, sprockets, and rollers track shoes.
2	(**)	Oil leaking from oil filter cover gasket.	13	(**)	Remove painted dirt on conical rollers and turntable.
3	(*)	Adjust fan and generator belt, loose.	14	(**)	Lubricate all gears, levers, rods, pins, and cables, after cleaning of painted dirt.
4	(*)	Adjust governor belt, loose.	15	(*)	Repair dent on panel and sliding door of cab.
5	(**)	Dismount exhaust flexible pipe and weld on mounting flange to exhaust manifold.	16	(**)	Replace bared wiring generator to voltage regulator.
6	(*)	Battery missing.	17	(**)	Clean magneto points, spark plugs, and carburetor power unit, and test operation.
7	(*)	Cables boom and hoist missing.	18	(*)	Replace all 110-V bulbs cabin and floodlights.
8	(*)	Bridle assembly, suspension cables and pins missing.	19	(*)	Top floodlights missing.
9	(**)	Adjust clutches swing drums.	20	(*)	Horn missing.
10	(**)	Install boom and extension assemblies.			
11	(**)	Replace missing extension bolts and mounting pins boom.			

*Damage/pilferage after receipt in Vietnam.

**Condition when received in Vietnam.

PETRUS KY

Model: 3057C.

SN #3A-18018.

ALL INSPECTIONS AND EQUIPMENT CONDITIONS RECORDED ON THIS FORM HAVE BEEN DETERMINED IN ACCORDANCE WITH DIAGNOSTIC PROCEDURES AND STANDARDS IN THE TM CITED HEREON

8a. Signature (*Person(s) performing inspection*): Mr. Borja, TCN, Maint. Branch, USAID/LOG.

9a. Signature (*Maintenance Supervisor*): David May, Maint. Branch = USAID/LOG.