DETERMINED IN ACCORDANCE WITH DIAGNOSTIC PROCEDURES AND STANDARDS IN THE TM CITED HEREON

8a. Signature (Person(s) performing inspection) Mr. Borja, TCN, Maint. Branch USAID/LOG.

9a. Signature (Maintenance Supervisor) David May, Maint. Branch USAID/ LOG.

TM item No.		Deficiencies and shortcomings		Sta- tus	Deficiencies and shortcomings
1	(**)	Spark plugs, contact points, condenser; defective.	12 13	(**) (**)	Clytch disc frozen. Brake band parking, frozen.
2	(**)	Clean and service generator, starter motor and carburetor assemblies.	14 15	(*)	Windshield cracked. Hinge cab door frozen.
3	(**)	Dismount and clean radiator, fins, block, by dirt and execessive paint.	7	(**)	Door torn; Straighten and weld torn portion. Window glass channels on door rotten and
4	(**)	Fuel tank, fuel lines; fuel pump bowl dirty.		``'	binding.
5	(**)	Gasket mounting, engine governor, and generator; leaking.	17	(**)	Window glass, regulators, door and rear; corroded.
6	(**) (**)	Seals, steering knuckles; leaking. Seal steering sector shaft; leaking.	18	(*)	Mounting nut and lever knob; service light switch missing.
8	(**)	Muffler assembly rotten.	19	(*)	Fuse turn signal lights missing.
9	(**)	Seal compansion flange; front differential leaking.	20 21	(*) (*)	Bulbs panel lights missing. Bulbs, turn signal lights; front, clearance
	(**) Ltti	Shaft, rod, and pins, clutch pedal; corroded.		``	lights missing.

APPLICABLE REFERENCE

TM Number: VN-E-6470-12. TM Date: L/SMB.

6. Type inspection: TI.

ALL INSPECTIONS AND EQUIPMENT CONDITIONS RECORDED ON THIS FORM HAVE BEEN DETERMINED IN ACCORDANCE WITH DIAGNOSTIC PROCEDURES AND STANDARDS IN

THE TM CITED HEREON
Sa. Signature (person(s) performing inspection): Mr. Borja, TCN, Maint.
Branch USAID/LOG.

9a. Signature (Maintenance Supervisor): David May, Maint. Branch USAID/ LOG.

TM Sta-	TM Sta-
item tus Deficiencies and shortcomings	item tus Deficiencies and shortcomings
No.	No.
1 (**) Floodlights not mounted. 2 (**) Boom missing. 3 (**) Hook block missing. 4 (**) Bridle assembly missing (Crossover sheaves for boom). 5 (**) All 4 outrigger locking pins missing. 6 (*) Batteries missing.	CARRIER CRANE 10T, BAY CITY, TDXC NMC NO. 10462 SN NO. 7893 1 (*) Windshield wiper arm assembly missing. 2 (*) Door glass cracked. 3 (**) Transmission top gasket leaking. 4 (**) No output from generator. 5 (*) Right front fender bent.

^{*}Damage/pilferage after receipt in Vietnam.