96090: Generator and fuel pump missing.
COUTS. Clutch and distributor missing
10000: I uel Dilmo missino
10387: Complete.
13096 : Clutch, fuel pump missing. 99370 : Complete.
98269: Fuel Pump missing.
17321: Generator missing.
76485: Distributor and Fuel Pump missing.
12823 : Complete.
50806: Carburetor missing.
10863: Fuel Pump missing
18755: Clutch and Carburetor missing
1000t, Utiliti missing
40706: Distributor and Fuel Pump missing
oritia. Oailuirefor and thal numb missis
ooos . Generator and Clutch missing
00100 : Fuel nilmo missino
46580: Complete.
98445: Clutch missing.
14494: Clutch and Carburetor missing.
46004: Fuel Pump, Clutch missing.
38226: Distributor missing.
e. Two of the remaining 24 engines were disassembled and inspected. Engine with Serial No. 46004 had been rebuilt, the cylinders were bored .030 oversize and the crankshaft had been ground to .020 undersize, it had new pistons. rings arburetors
arburetors
사이지 아마리 아마리 그 프로그램 프로프로프로프로프로프로프로프로프로프로프로프로프로프로프로프로 사이트 이번 그리아 이번 그리아 이는 이번 이번 아니다.
On the same basis we can assume that 50 of the engines were never rebuilt. esponsibility for damage that resulted from improper stores by
- Tot damage that resulted from impropose of and

that resulted from improper storage but do not feel that missing parts and the unrepaired condition of some of the engines is our responsibility.

## DEPARTMENT OF STATE

APRIL 7, 1967.

To—AID/Washington TOAID-A-3825. From-USAID/Saigon. Subject—608 Excess Property—Jeeps. Reference—VN-E-6337-120.

1. Nine jeeps arrived under the referenced P.O. which apparently received nothing but a heavy coat of paint without preparation of surface.

2. Inspection on arrival reveal entire lot of vehicles were given only coat of paint even on engines and inside surface of radiators without benefit of steam cleaning. Rubber components were not replaced but painted over. Also, coils, distributors, carburetors etc. Improperly cleaned parts of engine and body were painted over and paint can be peeled off readily. Motormounts were rotten and should have been replaced. Canvass seat covers were rotted and in a deplorable

3. All excess vehicles now undergo deprocessing which should only include