


This gore has had its share of skid marks, and again in this location you have guardrails starting here and guardrails starting here [indicating], which are hazards of themselves and desirably should be down to ground level and anchored.



This is a section of gore. This is just off the project, but again a place where a guardrail has been applied similar to the last picture, and it has been struck as you can see.

That is not too good delineation there, nor too good protection of the area.

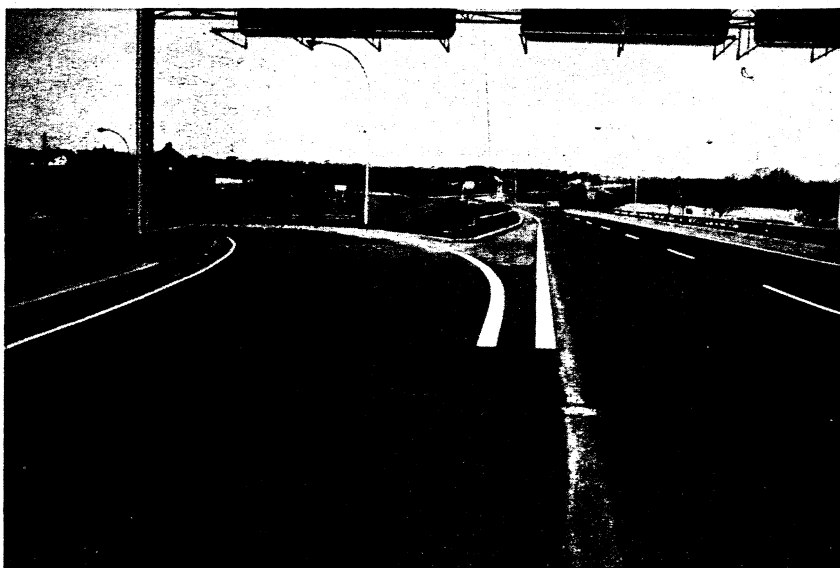